
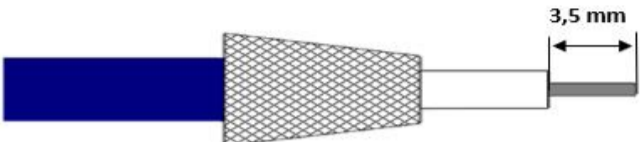
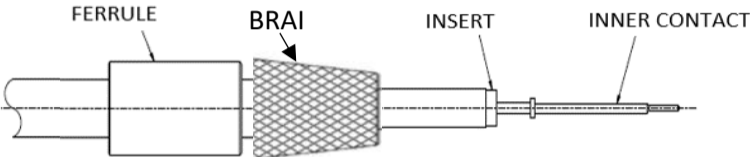
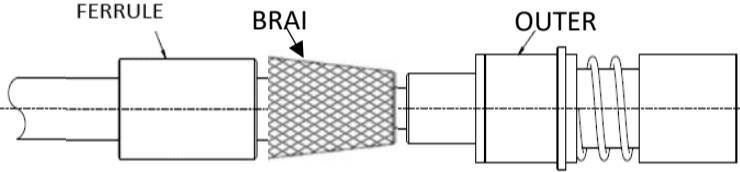
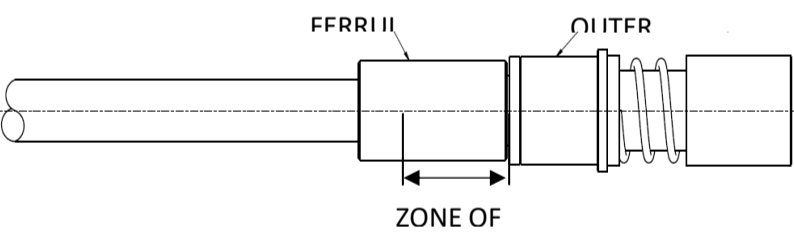


Wiring instruction for coax contact

PICTURE	PROCESS	CHECK	TOOLS
	<p>STRIP THE JACKET SLIDE THE CRIMPING FERULE</p>	<p>DO NOT DAMAGE THE BRAID</p>	<p>BLADE</p>
	<p>TRIM SHIELD STRIP CABLE CORE</p>	<p>DO NOT DAMAGE THE INNER CONDUCTOR</p>	<p>BLADE</p>
	<p>SLIDE INSERT OVER CABLE CENTER CONDUCTOR SLIDE INNER CONTACT OVER CABLE CENTER CONDUCTOR CRIMP INNER CONDUCTOR</p>	<p>THE INNER CONDUCTOR SHALL BE VISIBLE THRU THE INSPECTION HOLE</p>	<p>M 22520/2-01 WITH POSITIONNER M 22520/2- 35 (5)</p>
	<p>SLIDE THE OUTER ASSEMBLY</p>		
	<p>FOLD DOWN THE BRAID IN THE BARREL SLIDE THE FERULE IN THE BARREL CRIMP THE FERULE</p>	<p>CRIMP IN THE ZONE OF CRIMPING CUT THE EXCESS BRAID</p>	<p>M 22520/5-01 WITH DIE M22520 /5-05 (B)</p>

172-603530-83A