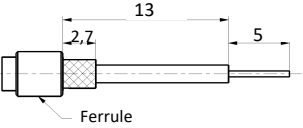
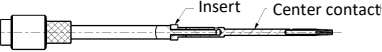
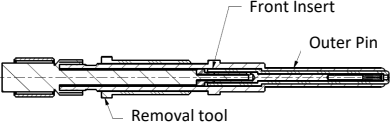



WIRING INSTRUCTION FOR COAX S16

PICTURE	PROCESS	CHECK	TOOLS
 <p>Ferrule</p>	<p>SLIDE FERRULE OVER CABLE STRIP THE CABLE</p>	<p>DO NOT DAMAGE THE BRAID</p>	<p>BLADE</p>
 <p>Insert Center contact</p>	<p>SLIDE THE INSERT AND THE CENTRE CONTACT OVER CENTRE CONDUCTOR CRIMP CENTRE CONTACT</p>		<p>M22520/2C-01 WITH POSITIONNEUR (EN4008-015) K370 (2)</p>
 <p>Front insert Outer Pin Removal tool</p>	<p>SLIDE THE FRONT INSERT OVER THE CENTER CONTACT SLIDE THE REMOVAL TOOL OVER THE OUTER PIN SLIDE THE OUTER PIN OVER THE FRONT INSERT</p>		
 <p>0,05 mini</p>	<p>CRIMP THE FERRULE THE FERRULE MUST BE NOT EXCEED THE BEGINNING OF THE GROOVE</p>		<p>M22520/5-01 WITH POSITIONNER M22520/5-08 A</p>

172-603530-37C