 
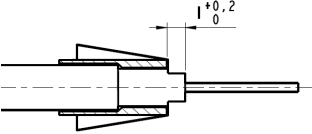
 
 


WIRING INSTRUCTION FOR COAX

PICTURE	PROCESS	CHECK	TOOLS
	<p>STRIP THE CABLE SLIDE THE FERRULE ON THE WIRE</p>	<p>DO NOT DAMAGE THE BRAID</p>	<p>BLADE</p>
	<p>COMB AND FOLD BACK THE BRAID STRIP THE WIRE CORE AS SHOWN BELOW</p>	<p>DO NOT DAMAGE THE BRAID</p>	
	<p>SLIDE THE INSERT AND THE CENTRE CONTACT OVER THE CORE. CRIMP THE CENTRE CONTACT.</p>		<p>M22520/2-01 WITH POSITIONER K881S (3)</p>
	<p>SLIDE THE FRONT INSERT AND SET WIRED ASSEMBLY INTO THE BODY. CRIMP THE BODY.</p>		<p>M22520/31-01 WITH POSITIONER G2P844</p>

182-603530-26B