

RFM QUADRAX INSTRUCTION MANUAL



Application

Only the following part numbers are concerned by this present document :

P/N	Body		Inner contact		
	Designation	Cable section 0.13-0.3mm ²	Cable section 0.3-0.6mm ²	Cable section 0.6-1.5mm ²	
612089	Male body (with pin)	612083	612085		612087
612090	Female body (with sockets)	612084	612086		612088

Tools

#16 Crimping tool/
#16 M22520/1-01



DMC UH2-5
positioner



RFM ODE Q



RFM ODE Q4




Assembly instruction


Stripping length

Cable must be stripped with a suitable tool to avoid damaging the core, insulating sheath and the braid. Strip a suitable length as shown on the picture below.

1 - Outer Braid Termination

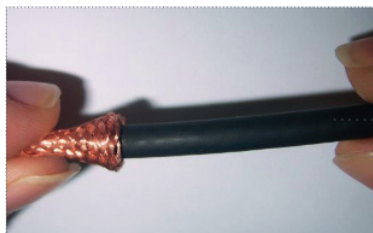

1.1

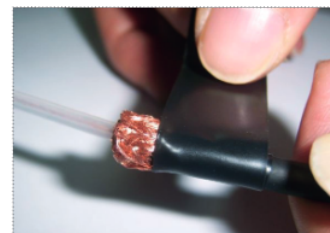

1.2

Picture 1

1.1 Pull the braid backwards over the cable jacket.

1.2 Use insulating tape or shrink tube to maintain it in place, leaving 7mm braid out of the insulating tape or shrink tube.